

# Work Order ID 77305

December-02-11 9:57:52 AM

**\*77305\***

Page 1

Item ID: D412-664-203TRN

Accept

**\*N900040100\***

Setup Start

**\*NS1\***

Revision ID:

Stop

**\*NS2\***

Item Name: Crosstube Turning Detail

Start Date: 02/12/2011 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 16/12/2011 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: M.L.J

Date: 11/12/02 Tooling:

Date:

Run Start

**\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop

**\*NR2\***

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

Draw Nbr

Revision Nbr

D412-664-243

Rev E(DEO)

0.00

100

**\*100\***

MORI SEIKI CNC LATHE LARGE

0.00

Mori Seiki

Memo

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA166

2-Turn first side as per Folio FA166

3- File transition lines smooth.

FOLIO REV: AA

DWG REV: E

0.00

110

**\*110\***

QC1- Inspect dimensions to dimension sheet

0.00

QC

Memo

Quality Control

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Work Order ID 77305

December-02-11 9:57:52 AM

**\*77305\***

Page 3

Item ID: D412-664-203TRN

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Item Name: Crosstube Turning Detail

Stop **\*NS2\***

Start Date: 02/12/2011 Start Qty: 1.00 **\*1\***

Cust Item ID:

Required Date: 16/12/2011 Req'd Qty: 1.00 **\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

145

0.00

**\*145\***

Crosstubes

Memo

0.00

Crosstubes

GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.

*JW*

*11-12-5*

150

Crosstubes Chemical Conversion

0.00

**\*150\***

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

*mo/*

*11-12-05*

160

QC3- Inspect Part Finish

0.00

**\*160\***

QC

Memo

0.00

Quality Control

*DP*

*11-12-5*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 77305****\*77305\***

Page 4

December-02-11 9:57:52 AM

Item ID: D412-664-203TRN

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Turning Detail

Start Date: 02/12/2011 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 16/12/2011 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
170		0.00							
<b>*170*</b>	Packaging								
Packaging	Memo	0.00							
Packaging	Identify and stock in kanban rack Location: <u>LG</u>		MO		11-12-05				
180		0.00							
<b>*180*</b>	QC21- Final Inspection - Work Order Release								
QC	Memo	0.00							
Quality Control									

11/12/6 DJ

MF

11-12-06

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



# Picklist Print

December-02-11 9:57:56 AM

Page 1

Work Order ID: 77305

**\*77305\***

Parent Item: D412-664-203TRN

**\*D412-664-203TRN\***

Parent Item Name: Crosstube Turning Detail

Start Date: 02/12/2011

Required Date: 16/12/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec  
IPP Rev B 08.04.02 Removed polish EC verified by: DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D6009-129		Manufactured	No			120	Each	4.0000	1	1			
-----------	--	--------------	----	--	--	-----	------	--------	---	---	--	--	--

**\*D6009-129\***

**\*\***

Crosstube Material

Location

Loc Qty

Loc Code

LG

4

65179

4

1 mm. L 11/12/02

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

<b>DART AEROSPACE LTD</b>	<b>Work Order:</b> 77305
<b>Description:</b> Crosstube Assembly (412 High Aft)	<b>Part Number:</b> D412-664-243
<b>Inspection Dwg:</b> D412-664-243 <b>Rev:</b> E	<b>Page 1 of 1</b>

### FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.684	+0.005/-0.000	2.688	✓		Vern	OK 06
	2.748	+0.005/-0.000	2.752	✓			
	2.884	+0.005/-0.000	2.889	✓			
	3.019	+0.005/-0.000	3.024	✓			
	3.163	+0.005/-0.000	3.168	✓			
	3.308	+0.005/-0.000	3.311	✓			
	3.429	+0.005/-0.000	3.429	✓			
	2.990	+0.005/-0.000	2.993	✓			
	2.618	+0.005/-0.000	2.622	✓			
	0.200	+/-0.010	.200	✓			
	R0.063	+/-0.010	.063	✓			
	R0.500	+/-0.010	.500	✓			
	4.971	+/-0.030	4.971	✓			
SIDE B	2.684	+0.005/-0.000	2.688	✓			
	2.748	+0.005/-0.000	2.752	✓			
	2.884	+0.005/-0.000	2.888	✓			
	3.019	+0.005/-0.000	3.023	✓			
	3.163	+0.005/-0.000	3.168	✓			
	3.308	+0.005/-0.000	3.312	✓			
	3.429	+0.005/-0.000	3.429	✓			
	2.990	+0.005/-0.000	2.993	✓			
	2.618	+0.005/-0.000	2.622	✓			
	0.200	+/-0.010	.200	✓			
	R0.063	+/-0.010	.063	✓			
	R0.500	+/-0.010	.500	✓			
	4.971	+/-0.030	4.971	✓			
	124.100	+/-0.020	124.12	✓		Req	OK 07

<b>Measured by:</b> J. A.
<b>Date:</b> 11.12.03

<b>Audited by:</b> R.
<b>Date:</b> 11.12.04

<b>Prototype Approval:</b>	N/A
<b>Date:</b>	N/A

Rev	Date	Change	Revised by	Approved
A	04.06.16	New Issue (P/O D412-664-203)	KJ/JLM	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	07.05.08	Tolerance updated for dimension 4.971	KJ/JLM	
D	10.02.02	Dimension 124.100 was 124.09	KJ	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	Qty -243	Part Number	Description
1	X	D412-664-243	CROSSTUBE ASSEMBLY (412 HIGH AFT)
2	1	D6009-129	CROSSTUBE
3	2	D3595-063-570	RUBBER CUSHION
4	1	D2896-1	SUPPORT
5	2	D3189-1	CHAFING SHIELD
6	2	D2856-600-1009	ABRASION STRIP
7	4	MS21920-28	CLAMP
8	2	MS21920-30	CLAMP (OR MS21920-32)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

# **GENERAL NOTES:**

- MATERIAL: MANUFACTURED FROM D6009-129  
FINISHED LENGTH = 124.100±0.020 (BEFORE BENDING/TRIMMING)
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D412-664-243" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- WEIGHT: 47.0 lbs (PER IIN-D212-664)
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE THE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER

NO. 97305 M.L.J  
11/12/02

② DEO ATTACHED  
**RELEASED**  
R 2009-10-29

E	REFORMAT/REVISE GENERAL NOTES; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; RELOCATED FLAG #6 PER PAR 08-046 (ZN A6-3); ADD TOLERANCE (ZN B6-3, C4-3, C8-3 & C5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	09.09.30
D	REMOVE D2732-058, CHANGE TO D3595-063-570	PH	07.03.09
C	REMOVE D2856-600-1087, ADD D2732-058 & MAGNOBOND 6398, MS21920-32 WAS MS21920-30	MB	06.10.27
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	01.10.17
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. E
MFG. APPR.	PH	D412-664-243	SHEET 1 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_



NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

77305

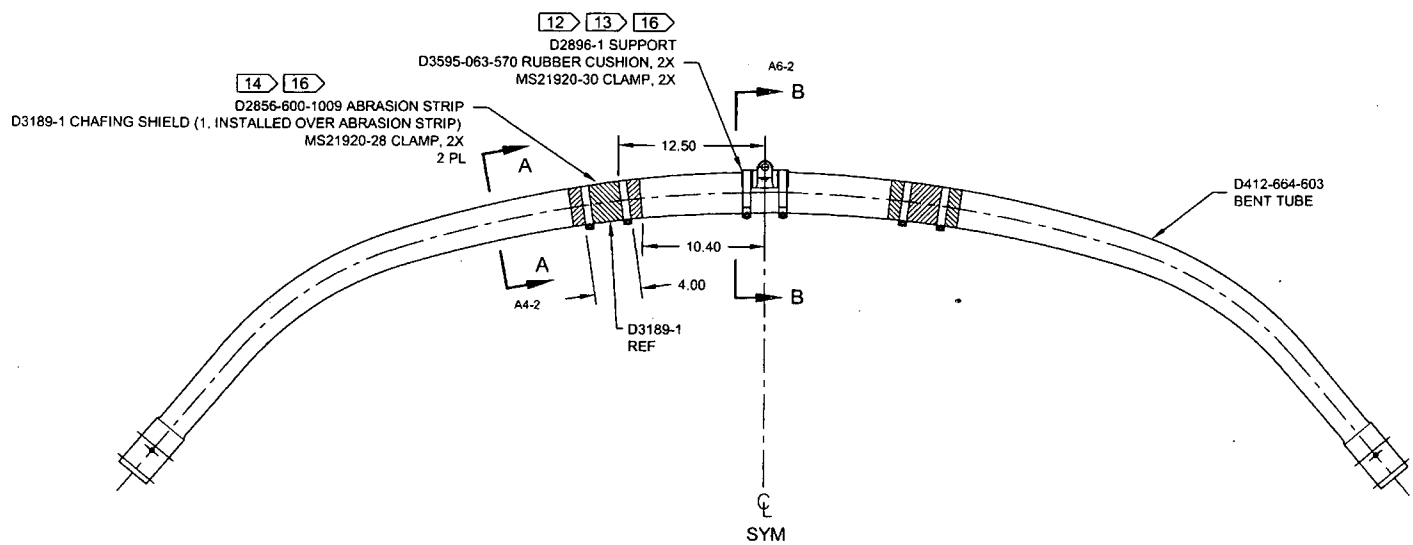

**D212-664-243**  
**ASSEMBLY DETAIL**

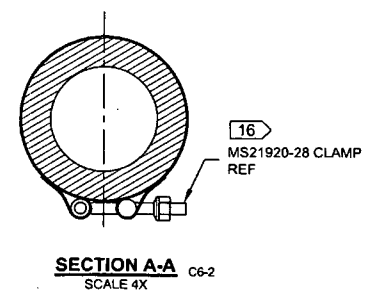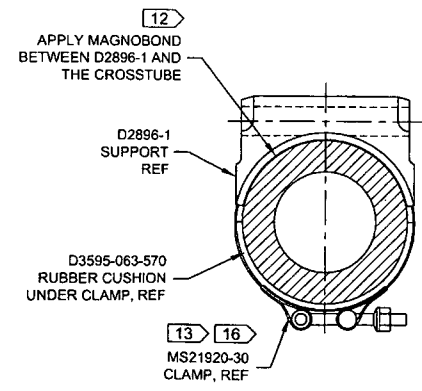

2 DEO ATTACHED

**RELEASED**  
2009-10-28  
NND

DESIGN	PH	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PS	DRAWING NO.	REV. E
MFG. APPR.	PS	D412-664-243	SHEET 2 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE REPRODUCED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_


Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



77305

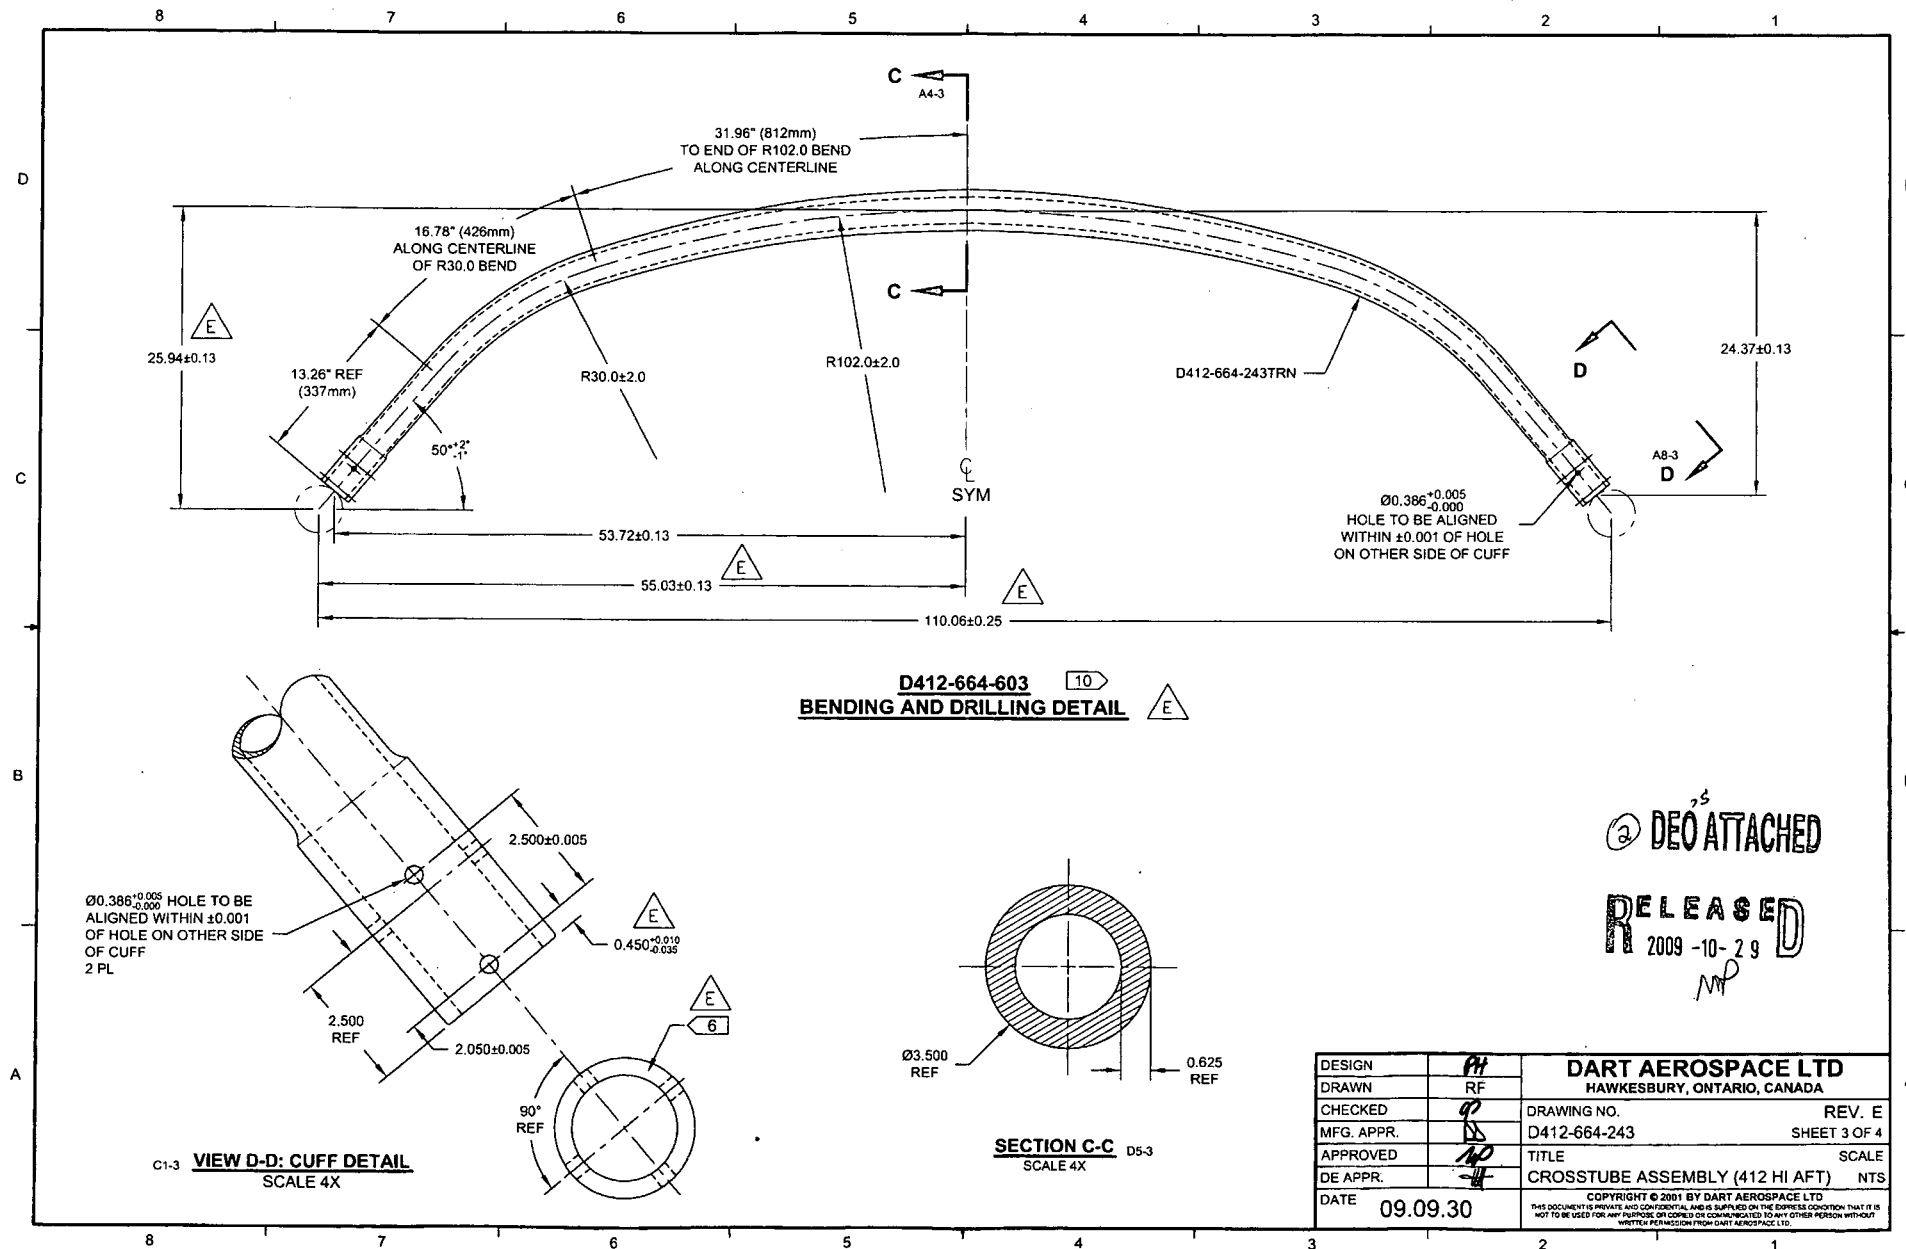

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries


side A

R1	R2
1-.311	1-.467
2-.307	2-.467
3-.302	3-.468
4-.303	4-.465

side B

R1	R2
1-.319	1-.477
2-.292	2-.457
3-.285	3-.457
4-.316	4-.475

77305

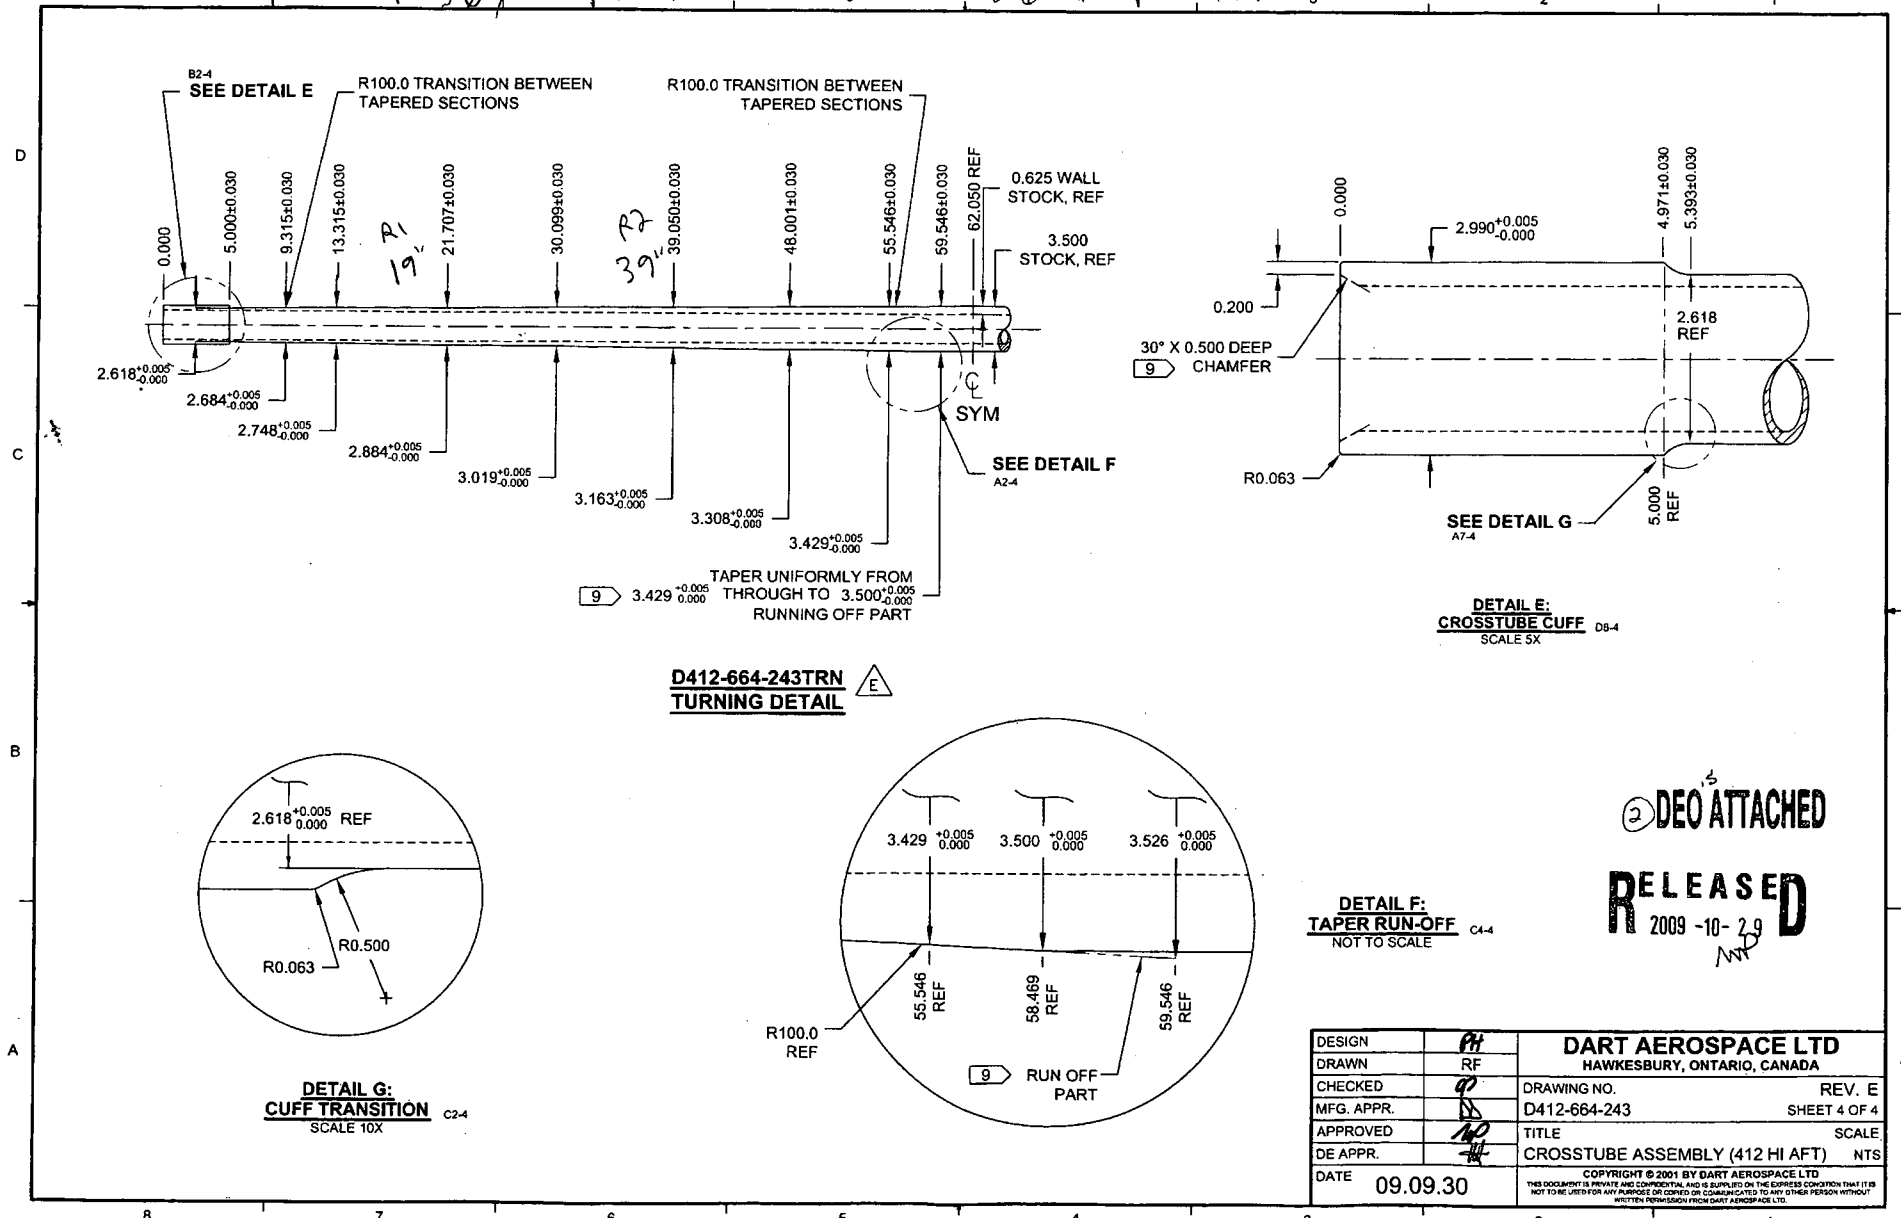

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

77305

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.			
DATE 11.03.31	DATE 11/03.31	DATE 11.03.31	DATE 11/03.31	DATE 11.03.31			

**PURPOSE:**

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

**CHANGE:**

PARTS LIST IS AMENDED AS FOLLOWS:

**IS:**

Item	Qty -243	Part Number	Description
6	0	D2856-600-1009	ABRASION STRIP

**WAS:**

6	2	D2856-600-1009	ABRASION STRIP
---	---	----------------	----------------

NOTES 2 AND 14, SHEET 1 ARE AMENDED AS FOLLOWS:

**IS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA)  
PAINT OUTSIDE PER DART QSI 005 4.2  
AFTER PAINTING, APPLY CLEAR COAT ON HATCHED AREA
- 14) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1  
CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL  
PROSEALED D3189-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF  
PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

**WAS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF  
CROSSTUBE PER QSI 035.

RELEASED  
2011-04-07  
MDL

# Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

77305

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-243-E-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.		
DATE 11.03.31	DATE 11.03.31	DATE 11.03.31	DATE 11.03.31	DATE 11.03.31		

**IS:**

D3189-1 CHAFING SHIELD (1, INSTALLED OVER PROSEAL 890)  
MS21920-28 CLAMP, 2X  
2 PL

D412-664-603  
BENT TUBE

2.00  
1.00


**WAS:**

D2856-600-1009 ABRASION STRIP  
D3189-1 CHAFING SHIELD (1, INSTALLED OVER ABRASION STRIP)  
MS21920-28 CLAMP, 2X  
2 PL

D3189-1  
REF

**D412-664-243  
ASSEMBLY DETAIL**

RELEASED  
2011-04-07  
MD

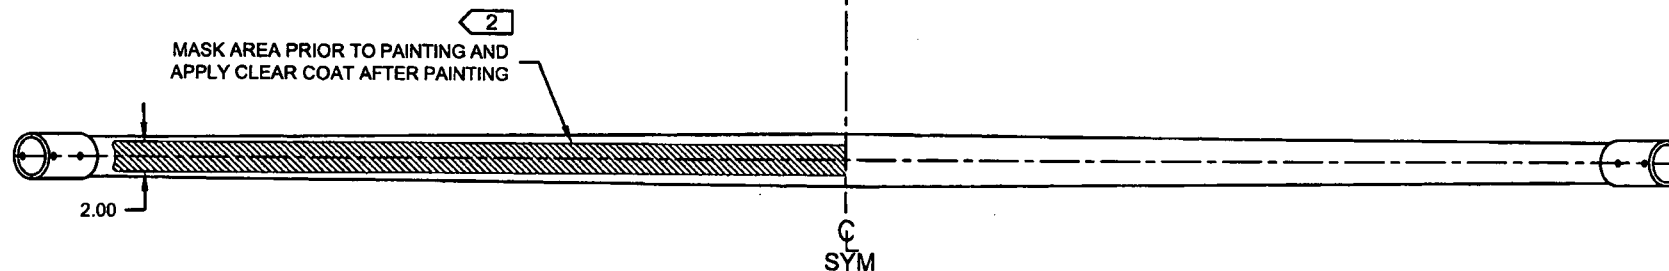

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



77305

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASS'Y (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>qp</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>RE</i>	APPROVED <i>WP</i>		DE APPR. <i>#</i>		
DATE 11.09.07	DATE 11.09.19	DATE 11.09.19	DATE 11.09.19		DATE 11.09.19		

**PURPOSE:**

REPLACE MAGNOBOND WITH 3M DP460 SCOTCH-WELD EPOXY ADHESIVE

**CHANGE:**

IS:

Item	Qty -243	Part Number	Description
9	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 &amp; 16, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) INSTALL D2896-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.**

WAS:

- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

**RELEASED**  
2011-09-29  
*WP*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries